

Overview


Choose EarTips




Push both EarBuds into charging case to activate them then take out from the case and they will auto power on and pair with each other. Right EarBud will auto enter pairing mode

when LED on left EarBud turns off. On cellphone, search for

OCY-T1 R and tap to connect cellphone to both EarBuds.

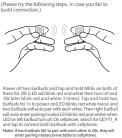




Method 1: take earphones out from the charging case and they will auto power on (LED glows solid white

Functions

Power-on

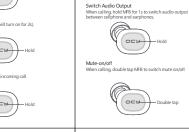

Answer Call

Tap MFB to answer incoming call and tap again to end it.

- Double tap

This equipment has been tested and found to comply with the

limits for a Class B digital device, pursuant to Part 15 of the

FCC Rules. These limits are designed to provide reasonable

protection against harmful interference in a residential installation.

This equipment generates uses and can radiate radio frequency

energy and, if not installed and used in accordance with the

instructions, may cause harmful interference to radio communications.

However, there is no guarantee that interference will not occur

in a particular installation. If this equipment does cause harmful

interference to radio or television reception, which can be

determined by turning the equipment off and on, the user is

encouraged to try to correct the interference by one or more

Increase the separation between the equipment and receiver.


-- Connect the equipment into an outlet on a circuit different

-- Consult the dealer or an experienced radio/TV technician for help.

This device complies with part 15 of the FCC Rules. Operation

(1) This device may not cause harmful interference, and (2)

this device must accept any interference received, including

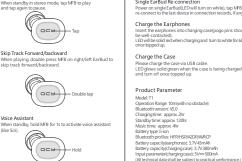





Perform standard: O/HL 1-2016 O/HL 2-2017

Manufacturer: Dongguan Hele Electronics Co., Ltd.

Address: Daoiiao Town, Dongguan City, Guangdong, China

while, the headset will exit pairing mode, please re-enter the mode: if a procedure error of your phone occurs, reboot it; if a procedure error of the headsetoccurs, reboot or reset it. Caveats 1. Never disassemble or modify your headset for any reasons to avoid any damages and danger. Do not store the headset in extreme temperatures (under 0°C or over 45°C). 3. Avoid using the indicator close to the eyes of children or animale 4. Do not use this headset during a thunderstorm to avoid irregular function and increased risk of electricshock. 5. Do not use harsh chemicals or strong detergents to clean the headset. Keep the headset dry.

3. If the headset is left unused for over two weeks, please Supposing any defects caused by quality issues occur within the warranty period, please take this warranty 4. Please use the chargers made by qualified manufacturer. card and purchase receipts to your distributor for free 5. If the headset cannot be found by your phone, please check

Warranty Period

exchange service.

Model Number

User's Name:

User's Phone:

User's Address:

Shop's Name:

Comments:

dropping off.

Shop's Address:

Date of Purchasing:

Free Service:

1. Refore using the headset, please read the manual.

2. The headset need to be fully charged prior to first-time use.

whether it is in pairing mode; if left unconnected for a long

carefully and keep it for future references.

recharge it periodically.

Free exchange service will not be accessed under

3. Damages by act of God. Supposing your item is within

any damages or defects except the above circumstances,

please return to us or your distributor for free repairing.

Warranty Card

12 months after you purchase this item.(or you may

inquire your local shopper for more details.)

following circumstances:

 Damages caused unauthorized disassembly. 2. Defects or physical damages caused by leaking or

Changes or modifications not expressly approved by the party operate the equipment.

of the following measures:

FCC Statement



-- Reorient or relocate the receiving antenna.

is subject to the following two conditions:

from that to which the receiver is connected.

interference that may cause undesired operation.

MADE IN CHINA FCC ID: RDR-026